

Sat Nav, ICE, Audio & TV

Phone preparation - Bluetooth not working

Problem

The phone or the fixed installation headset (only with PR No. 9ZW) cannot be connected with the vehicle via Bluetooth.

Affected phone systems:

9ZF - phone preparation

9ZW - Bluetooth car phone (headset with colour screen)

Technical background

Incorrect adjustment of the phone control unit at the factory.

Production change

Adjustment modified.

Measure

If the approved phone (see www.audi.de/telefon) or the fixed installation headset cannot be connected

via Bluetooth, check the adjustment channel 133 of the phone control unit. The adjustment channel 133 must have the value "1".

Adjustment channel 133:

value **0** = Bluetooth **off**

value **1** = Bluetooth **on**

Sat Nav, ICE, Audio & TV

Unique solution ID: #1038

Author: Nick

Last update: 2013-02-23 00:13